INSTRUMENT APPROACH CHART **(IAC)**

MACAÉ / Plataforma PETROBRÁS 51 P-51 (SBLI)

RNP 100

PINS - (CAT H)

HELPN ELEV: 195'

DEPARTAMENTO DE CONTROLE DO ESPAÇO AÉREO

ATIS	*APP MACAÉ*	*TWR*	*GNDC*
NIL	**130.30 126.90 130.85 120.00**	**NIL**	**NIL**


N/A	*FINAL CRS* **100º**	*FAF:* **1300'**	***N/A***	*LNAV* *MDA / (OCH):* ***700' / (510')***


APCH Perdida: Subir para **2000'**. Manter o rumo **100** até LI036 para espera.

Missed APCH: Climb to **2000'**. *Maintain course* **100** *until LI036 for holding.*

RMK: 1) Procedimento poderá ser utilizado para helideques situados até 10NM de LI034. 2) Requerida autorização do APP-ME para início do procedimento. 3) Requerido FPL "Y" com mudança de regras de voo para VFR em LI034.

1) Procedure may be authorized for helidecks situated within 10NM from LI034. 2) Authorization required from APP-ME to iniciate the procedure. 3) FPL "Y" required with flight rules change to VFR at LI034.

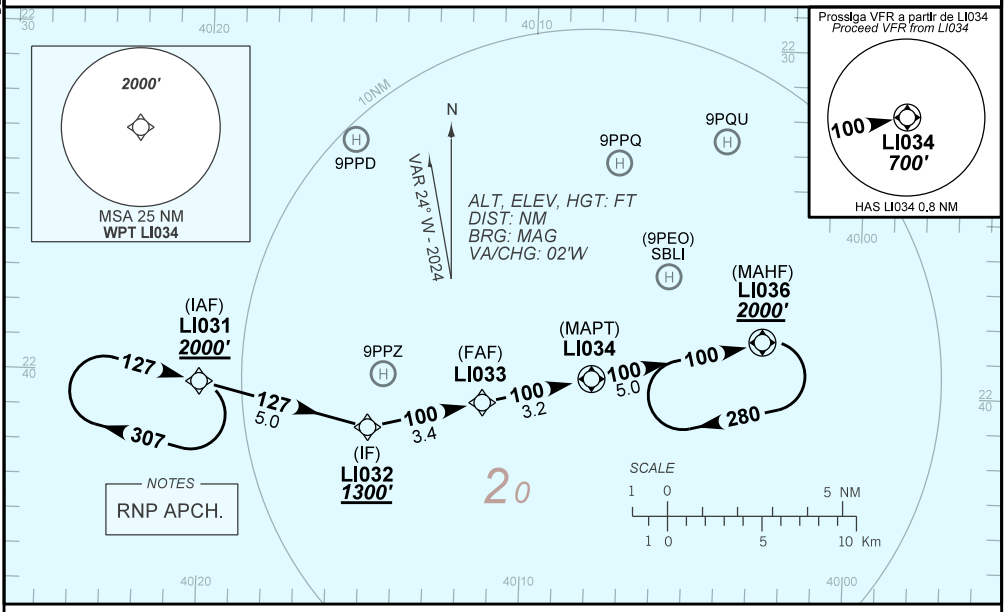

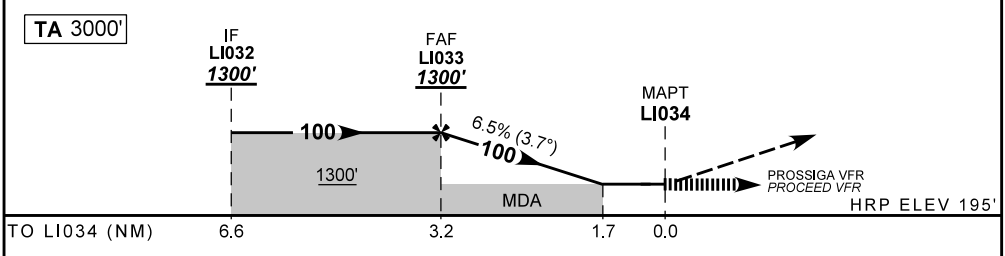

		LI033	**3.0**	**2.0**	**1.7**	LI034	*Ground Speed* (KT)	060	070	080	090
		1300	**1185**	**790**	**700**	ALT	FPM	**390**	**460**	**520**	**590**
		NIL				(HGT)	FAF-MAPT	NA			

CHANGES: VAR.

STRAIGHT-IN	**CAT**	**H**
LNAV	**MDA / (OCH)**	**700' / (510')**
	VIS (m)	1500
CIRCLING	**MDA / (OCH)**	**NA**
	VIS (m)	