

**INSTRUMENT APPROACH
CHART (IAC)**

DOURADOS / Dourados (SBDO)

NDB RWY 06

(CAT A, B, C)

AD ELEV: 1500'



DEPARTAMENTO DE CONTROLE DO ESPAÇO AÉREO

ATIS NIL	APP NIL	AFIS DOURADOS 130.10	GNDC NIL
-------------	------------	-------------------------	-------------

NDB DOU 285 KHz	FINAL CRS 049°	N/A	N/A	NDB MDA / (OCH): 1950' / (470')
--------------------	-------------------	-----	-----	------------------------------------

APCH Perdida: Subir para **4000'**. Manter QDR **049** do NDB DOU até **3000'**. Após, curvar à DIREITA direto NDB DOU para espera.

Missed APCH: Climb to **4000'**. Maintain **049** QDR DOU NDB until **3000'**. After, turn RIGHT direct DOU NDB for holding.

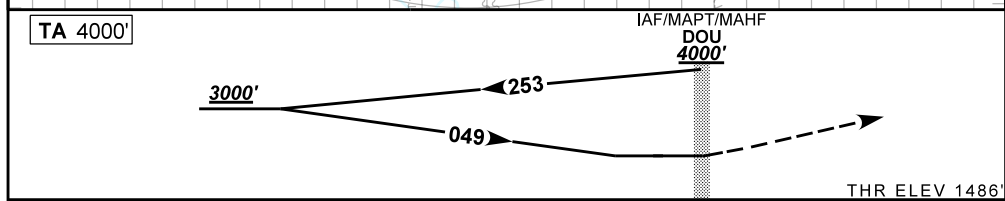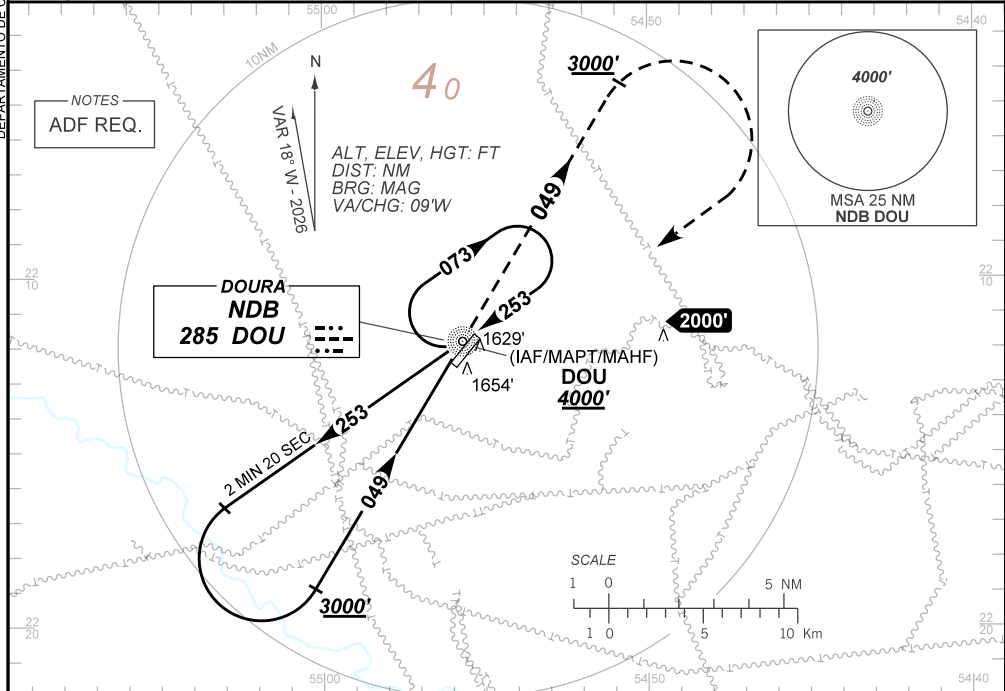

NIL	RWY06	Ground Speed (KT)	090	110	130	150	170	190
NIL	ALT	FPM	650			NA		
NIL	(HGT)	FAF-MAPT	NA					

STRAIGHT-IN	CAT	A	B	C	D	E
NDB	MDA / (OCH)	1950' / (470')			NA	
	ALS/NO ALS/ RVR ALS (m)	NIL / 1600 / NIL		NIL / 2200 / NIL		
CIRCLING	MDA / (OCH)	NA				
	VIS (m)					

CHANGES: LAYOUT, OBST. PROC. VAR.

AIRAC AMDT 2603A1 19 MAR 26

SBDO_IAC_00D 1/1
IAC NDB RWY 06