

**INSTRUMENT APPROACH
CHART (IAC)**

OIAPOQUE / Oiapoque (SBOI)

NDB Z RWY 03

(CAT A, B, C)

AD ELEV: 53'



ATIS NIL	APP NIL	AFIS OIAPOQUE 125.90	GNDC NIL
NDB OIA 340 KHz	FINAL CRS 021°	NA	NDB MDA / (OCH): 820' (770')

APCH Perdida: Subir para 3000' no QDR 060 NDB OIA. Após cruzar 1500', curvar à DIREITA direto para NDB OIA para espera.

Missed APCH: Climb to 3000' on 060 QDR OIA NDB. After passing 1500', turn RIGHT direct to NDB OIA for holding.

RMK: NIL.

DEPARTAMENTO DE CONTROLE DO ESPAÇO AEREO

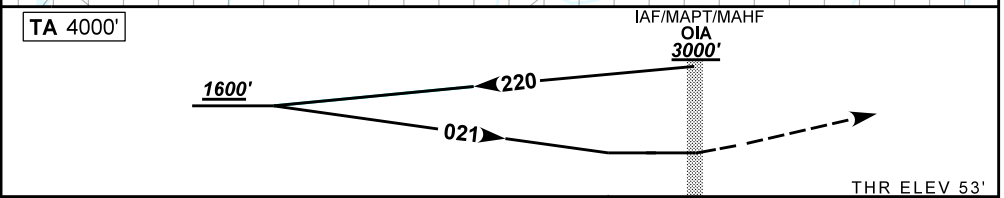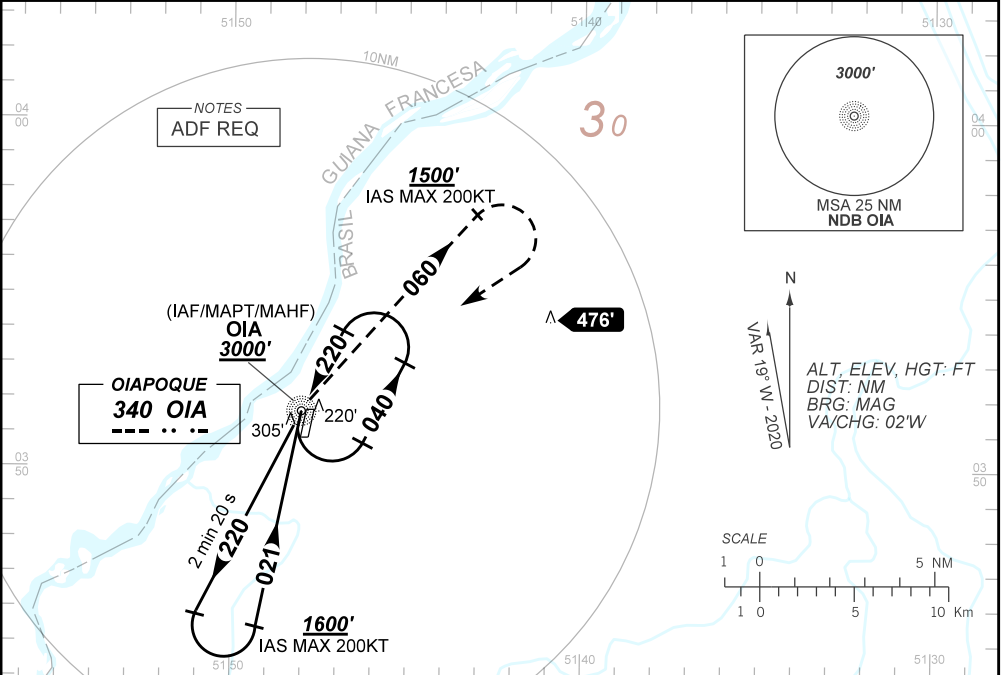

TO THR 03 (NM)

NIL	RWY03	KT	090	110	130	150	170	190
NIL	ALT	FPM	650			NA		
NIL	(HGT)	FAF-MAPT	NA					

STRAIGHT-IN	CAT	A	B	C	D	E
NDB	MDA / (OCH)	820' / (770')				NA
	ALS/NO ALS/ RVR ALS (m)	NIL / 1600 / NIL	NIL / 2000 / NIL	NIL / 3600 / NIL		
CIRCLING	MDA / (OCH)	NA				
	VIS (m)					

CHANGES: ADEL, DEC/VAR, LAYOUT, MDA, PROC, THEL